



WEEKLY SUMMARY REPORT – CONTRACT WEEK 32

21-036 EAST NAPLES BAY

DREDGING AND ROCK REMOVAL PROJECT



| | | | |
|---------------------------------------|----------------------------------|---|-------------------------------|
| Date: 4/29/2024 to 5/3/2024 | | | |
| Inspectors: Mackenzie Hudson | Stantec PIN: 2028113191 | Accidents <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | |
| Days of Week: Monday to Friday | Contract Days: 218 to 222 | Total Days: 222 | Accident Report #: N/A |
| Canal(s) Worked In: A-A | | Stations Worked Between: 14+50 to 12+50 | |

General

Remarks

#1 – Prime Contractor – Quality Enterprises:

Monday 4-29-2024:

- Canal grinding in progress today in Canal A-A starting, approximately, at station 13+80. No sediment removal, only grinding.
- Contractor grinded rock from 8:00am to 12:20pm. Contractor left site at 12:20pm and returned at 1:30pm to resume grinding until 5:00pm. Contractor dropped the turbidity curtain and opened the canal 5:05pm.
- Contractor has a barge, an excavator, one hopper, and a push boat staged overnight at station 12+00 in Canal A-A and a support boat staged at station 6+00 in Canal A-A while working on this canal. Contractor also has one hopper staged in Canal CC-CC between stations 1+00 and 2+00. In addition, the contractor has a long reach excavator, Conex box, two (2) fuel cubes, and a water tank on trailer staged on the property located at 1300 Curlew Avenue, Naples, FL 34102. A GPS base station is also set up at this location during project work hours today.

Tuesday 4-30-2024:

- Canal grinding in progress today in Canal A-A starting, approximately, at station 13+80. Canal sediment removal also in progress today in Canal A-A starting, approximately, at station 14+50 and moving toward station 14+00 in the southwest direction.
- Contractor grinded rock from 8:00am to 10:20am. Contractor disconnected the Epiroc grinder from the 323 excavator and transported it to the staging area at 1300 Curlew Avenue for maintenance. Contractor returned to Canal A-A and connected the bucket attachment to the 323 excavator. Contractor left site at 1:10pm and returned at 2:10pm.
- Contractor dredged from 2:15pm to 2:50pm. Contractor transported hopper to staging area at 1300 Curlew Avenue from 2:55pm to 3:40pm. Contractor used long reach excavator to unload material from hopper onto staging area from 3:45pm to 4:00pm. Contractor transported the other hopper to Canal A-A from 4:00pm to 4:35pm.
- Contractor dredged from 4:40pm to 4:55pm. Contractor did not transported hopper to staging area at 1300 Curlew Avenue. Contractor staged the equipment and opened the canal at 5:05pm.



WEEKLY SUMMARY REPORT – CONTRACT WEEK 32

21-036 EAST NAPLES BAY

DREDGING AND ROCK REMOVAL PROJECT



- Contractor has a barge, an excavator, one hopper, and a push boat staged overnight at station 12+00 in Canal A-A and a support boat staged at station 6+00 in Canal A-A while working on this canal. Contractor also has one hopper staged in Canal CC-CC between stations 1+00 and 2+00. In addition, the contractor has a long reach excavator, Epiroc grinder, Conex box, two (2) fuel cubes, and a water tank on trailer staged on the property located at 1300 Curlew Avenue, Naples, FL 34102. A GPS base station is also set up at this location during project work hours today.

Wednesday 5-1-2024:

- Contractor transported hopper to staging area at 1300 Curlew Avenue from 8:55am to 9:35am. Contractor used long reach excavator to unload material from hopper onto staging area from 9:40am to 9:50am. Contractor transported the other hopper to Canal A-A from 9:55am to 10:30am.
- Port Consolidated delivered fuel to the staging area at 1300 Curlew Avenue from 9:10am to 9:20am.
- Canal sediment removal in progress today in Canal A-A starting, approximately, at station 14+00 moving toward station 13+80 in the southwest direction. No grinding, only sediment removal.
- Contractor dredged from 10:35am to 10:55am. Contractor transported hopper to staging area at 1300 Curlew Avenue from 11:00am to 11:40am. Contractor used long reach excavator to unload material from hopper onto staging area from 11:45am to 12:00pm. Contractor transported the other hopper to Canal A-A from 12:05pm to 12:40pm.
- Contractor dredged from 12:40pm to 1:15pm. Contractor did not transport hopper to staging area at 1300 Curlew Avenue. Contractor pumped water out of the barge before stopping work for the day. Contractor opened the canal and left site at 2:00pm.
- Contractor has a barge, an excavator, one hopper, and a push boat staged overnight at station 12+00 in Canal A-A and a support boat staged at station 6+00 in Canal A-A while working on this canal. Contractor also has one hopper staged in Canal CC-CC between stations 1+00 and 2+00. In addition, the contractor has a long reach excavator, Conex box, two (2) fuel cubes, and a water tank on trailer staged on the property located at 1300 Curlew Avenue, Naples, FL 34102. A GPS base station is also set up at this location during project work hours today.
- Two (2) hoppers of material removed.

Thursday 5-2-2024:

- Mechanic performed maintenance on the Epiroc grinder and 323 excavator at the staging area at 1300 Curlew Avenue from 8:30am to 3:00pm.
- Contractor used long reach excavator to unload material from hopper onto staging area from 1:10pm to 1:20pm. Contractor transported the other hopper to Canal A-A from 1:25pm to 2:05pm.
- Canal sediment removal in progress today in Canal A-A starting, approximately, at station 13+50 moving toward station 13+00 in the southwest direction. No grinding, only sediment removal.
- Contractor dredged from 2:10pm to 2:35pm. Contractor transported hopper to staging area at 1300 Curlew Avenue from 2:40pm to 3:25pm. Contractor used long reach excavator to unload material from hopper onto staging area from 3:30pm to 3:40pm while the push boat transported the other hopper to Canal A-A from 3:30pm to 4:15pm.



WEEKLY SUMMARY REPORT – CONTRACT WEEK 32

21-036 EAST NAPLES BAY

DREDGING AND ROCK REMOVAL PROJECT



- Mechanics transported Epiroc grinder off site at 3:50pm.
- Contractor dredged from 4:20pm to 4:40pm. Contractor did not transport hopper to staging area at 1300 Curlew Avenue. Contractor staged the equipment and opened the canal at 5:00pm.
- Contractor has a barge, an excavator, one hopper, and a push boat staged overnight at station 12+00 in Canal A-A and a support boat staged at station 6+00 in Canal A-A while working on this canal. Contractor also has one hopper staged in Canal CC-CC between stations 1+00 and 2+00. In addition, the contractor has a long reach excavator, Conex box, two (2) fuel cubes, and a water tank on trailer staged on the property located at 1300 Curlew Avenue, Naples, FL 34102. A GPS base station is also set up at this location during project work hours today.
- Two (2) hoppers of material removed.

Friday 5-3-2024:

- Contractor transported hopper to staging area at 1300 Curlew Avenue from 8:20am to 9:00am. Contractor used long reach excavator to unload material from hopper onto staging area from 9:05am to 9:20am while push boat transported the other hopper to Canal A-A from 9:05am to 9:40am.
- Canal sediment removal in progress today in Canal A-A starting, approximately, at station 12+75 moving toward station 12+50 in the southwest direction. No grinding, only sediment removal.
- Contractor dredged from 9:45am to 10:00am. Contractor transported hopper to staging area at 1300 Curlew Avenue from 10:05am to 10:45am. Contractor used long reach excavator to unload material from hopper onto staging area from 10:50am to 11:10am while the push boat transported the other hopper to Canal A-A from 10:55am to 11:30am.
- Contractor dredged from 11:35am to 12:00pm. Contractor transported hopper to staging area at 1300 Curlew Avenue from 12:30pm to 1:05pm. Contractor used long reach excavator to unload material from hopper onto staging area from 1:10pm to 1:30pm while the push boat transported the other hopper to Canal A-A from 1:10pm to 1:50pm.
- Contractor exited Canal A-A, staged the equipment, and opened the canal at 2:00pm.
- Contractor secured tires along seawall at the staging area at 1300 Curlew Avenue.
- Contractor has a barge, an excavator, one hopper, a support boat, and a push boat staged overnight at station 4+00 in Canal Main B1 while working on this canal. Contractor also has one hopper staged in Canal CC-CC between stations 1+00 and 2+00. In addition, the contractor has a long reach excavator, Conex box, two (2) fuel cubes, and a water tank on trailer staged on the property located at 1300 Curlew Avenue, Naples, FL 34102. A GPS base station is also set up at this location during project work hours today.
- Three (3) hoppers of material removed.

Note: Daily reports for the week attached.



DAILY REPORT OF CONSTRUCTION
 21-036 EAST NAPLES BAY
 DREDGING AND ROCK REMOVAL PROJECT



| | | | |
|------------------------------------|--------------------------------|------------------------------|---|
| Date: 4/29/2024 | | | |
| Inspector: Mackenzie Hudson | Stantec PIN: 2028113191 | | Accidents <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Day of Week: Monday | Contract Day: 218 | Week: 32 | Accident Report #: N/A |
| High Temp (°F): 87 °F | AM Conditions: Sunny | PM Conditions: Cloudy | High Tide: 4:04 PM – 2.8' |
| Low Temp (°F): 66 °F | Wind: 13 to 15 mph | Wind: 13 to 14 mph | Low Tide: 9:34 AM – 1.7' |
| Canal Worked In: A-A | Stations Worked Between: | 13+80 | |

General

#1 – Prime Contractor – Quality Enterprises:

- Canal grinding in progress today in Canal A-A starting, approximately, at station 13+80. No sediment removal, only grinding.
- Contractor grinded rock from 8:00am to 12:20pm. Contractor left site at 12:20pm and returned at 1:30pm to resume grinding until 5:00pm. Contractor dropped the turbidity curtain and opened the canal 5:05pm.
- Contractor has a barge, an excavator, one hopper, and a push boat staged overnight at station 12+00 in Canal A-A and a support boat staged at station 6+00 in Canal A-A while working on this canal. Contractor also has one hopper staged in Canal CC-CC between stations 1+00 and 2+00. In addition, the contractor has a long reach excavator, Conex box, two (2) fuel cubes, and a water tank on trailer staged on the property located at 1300 Curlew Avenue, Naples, FL 34102. A GPS base station is also set up at this location during project work hours today.

| Contractor(s) and Personnel | | | | | | | | | | |
|------------------------------------|--------------------------------------|-----------------|---|------|-------------------|---|------|-----------------|---|------|
| # | Name | Type | # | Hrs. | Type | # | Hrs. | Type | # | Hrs. |
| 1 | Prime: Quality Enterprises | PM | 0 | 0 | Field Supervisor | 0 | 0 | Foreman | 0 | 0 |
| | | Skilled Laborer | 1 | 10 | Unskilled Laborer | 1 | 10 | Safety Director | 0 | 0 |

| Equipment | | | | | |
|------------------|-----------------|------------------------|----------|-----------|---------------------|
| Cont/ Sub # | Equipment ID | Description | # Pieces | # Used | Total Hours Used |
| 1 | N/A | Barge | 1 | 1 | 8 |
| 1 | CAT 323 | Excavator - Barge | 1 | 1 | 8 |
| 1 | CAT 326 | Excavator – Long Reach | 1 | 0 | 0 |
| 1 | FL6223TB | Push Boat | 1 | 1 | 8 |
| 1 | FL2474PP | Support Boat | 1 | 1 | 3 |
| 1 | N/A | Hopper | 2 | 0 | 0 |

| Visitors | | | |
|-----------------|---------|-------------------|-----|
| Name | Company | Hours at Job Site | |
| | | From: | To: |
| | | | |
| | | | |

| Inspector Name and Position | Hours at Job Site/Office | | Total Hours |
|-----------------------------|--------------------------|-------------|-------------|
| Mackenzie Hudson, EIT – CEI | From: 8:00 AM | To: 5:00 PM | 8.0 hours |



☉ 360°N (T) ● 26°7'24"N, 81°47'2"W ±9ft ▲ 8ft



29 Apr 2024, 08:09:38

323 excavator grinding rock at station 13+80 in Canal A-A.



☉ 359°N (T) ☉ 26°7'24"N, 81°47'2"W ±9ft ▲ 6ft



29 Apr 2024, 10:24:37

323 excavator grinding rock at station 13+80 in Canal A-A.



☀ 358°N (T) ☉ 26°7'24"N, 81°47'2"W ±9ft ▲ 24ft



29 Apr 2024, 11:24:55

323 excavator grinding rock at station 13+80 in Canal A-A.



☀ 4°N (T) ● 26°7'24"N, 81°47'3"W ±9ft ▲ 2ft



29 Apr 2024, 13:41:57

323 excavator grinding rock at station 13+80 in Canal A-A.



☀ 4°N (T) ● 26°7'24"N, 81°47'3"W ±9ft ▲ 3ft



29 Apr 2024, 14:26:48

323 excavator grinding rock at station 13+80 in Canal A-A.



☀ 4°N (T) ☉ 26°7'24"N, 81°47'3"W ±9ft ▲ -1ft



29 Apr 2024, 15:16:41

323 excavator grinding rock at station 13+80 in Canal A-A.



☀ 2°N (T) ☉ 26°7'24"N, 81°47'3"W ±13ft ▲ 10ft



29 Apr 2024, 16:51:03

323 excavator grinding rock at station 13+80 in Canal A-A.



DAILY REPORT OF CONSTRUCTION
 21-036 EAST NAPLES BAY
 DREDGING AND ROCK REMOVAL PROJECT



| | | | |
|------------------------------------|--------------------------------|---|----------------------------------|
| Date: 4/30/2024 | | | |
| Inspector: Mackenzie Hudson | Stantec PIN: 2028113191 | Accidents <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | |
| Day of Week: Tuesday | Contract Day: 219 | Week: 32 | Accident Report #: N/A |
| High Temp (°F): 87 °F | AM Conditions: Sunny | PM Conditions: Cloudy | High Tide: 5:16 PM – 2.7' |
| Low Temp (°F): 66 °F | Wind: 10 to 11 mph | Wind: 8 to 13 mph | Low Tide: 10:30 AM – 1.8' |
| Canal Worked In: A-A | Stations Worked Between: | 14+50 to 13+80 | |

General

#1 – Prime Contractor – Quality Enterprises:

- Canal grinding in progress today in Canal A-A starting, approximately, at station 13+80. Canal sediment removal also in progress today in Canal A-A starting, approximately, at station 14+50 and moving toward station 14+00 in the southwest direction.
- Contractor grinded rock from 8:00am to 10:20am. Contractor disconnected the Epiroc grinder from the 323 excavator and transported it to the staging area at 1300 Curlew Avenue for maintenance. Contractor returned to Canal A-A and connected the bucket attachment to the 323 excavator. Contractor left site at 1:10pm and returned at 2:10pm.
- Contractor dredged from 2:15pm to 2:50pm. Contractor transported hopper to staging area at 1300 Curlew Avenue from 2:55pm to 3:40pm. Contractor used long reach excavator to unload material from hopper onto staging area from 3:45pm to 4:00pm. Contractor transported the other hopper to Canal A-A from 4:00pm to 4:35pm.
- Contractor dredged from 4:40pm to 4:55pm. Contractor did not transported hopper to staging area at 1300 Curlew Avenue. Contractor staged the equipment and opened the canal at 5:05pm.
- Contractor has a barge, an excavator, one hopper, and a push boat staged overnight at station 12+00 in Canal A-A and a support boat staged at station 6+00 in Canal A-A while working on this canal. Contractor also has one hopper staged in Canal CC-CC between stations 1+00 and 2+00. In addition, the contractor has a long reach excavator, Epiroc grinder, Conex box, two (2) fuel cubes, and a water tank on trailer staged on the property located at 1300 Curlew Avenue, Naples, FL 34102. A GPS base station is also set up at this location during project work hours today.
- One (1) hopper of material removed.

| Contractor(s) and Personnel | | | | | | | | | | |
|------------------------------------|--------------------------------------|-----------------|---|------|-------------------|---|------|-----------------|---|------|
| # | Name | Type | # | Hrs. | Type | # | Hrs. | Type | # | Hrs. |
| 1 | Prime: Quality Enterprises | PM | 0 | 0 | Field Supervisor | 0 | 0 | Foreman | 0 | 0 |
| | | Skilled Laborer | 1 | 10 | Unskilled Laborer | 1 | 10 | Safety Director | 0 | 0 |

| Equipment | | | | | |
|------------------|-----------------|------------------------|----------|-----------|---------------------|
| Cont/ Sub # | Equipment ID | Description | # Pieces | # Used | Total Hours Used |
| 1 | N/A | Barge | 1 | 1 | 4 |
| 1 | CAT 323 | Excavator - Barge | 1 | 1 | 4 |
| 1 | CAT 326 | Excavator – Long Reach | 1 | 1 | 2 |
| 1 | FL6223TB | Push Boat | 1 | 1 | 8 |
| 1 | FL2474PP | Support Boat | 1 | 1 | 1 |
| 1 | N/A | Hopper | 2 | 2 | 4 |

| Visitors | | | |
|-----------------|---------|-------------------|-----|
| Name | Company | Hours at Job Site | |
| | | From: | To: |
| | | | |
| | | | |

| Inspector Name and Position | Hours at Job Site/Office | | Total Hours |
|-----------------------------|--------------------------|-------------|-------------|
| Mackenzie Hudson, EIT – CEI | From: 8:00 AM | To: 5:00 PM | 8.0 hours |



☀ 5°N (T) ● 26°7'24"N, 81°47'3"W ±9ft ▲ 8ft



30 Apr 2024, 08:04:26

323 excavator grinding rock at station 13+80 in Canal A-A.



☀ 3°N (T) ☉ 26°7'24"N, 81°47'2"W ±9ft ▲ 14ft



30 Apr 2024, 09:39:48

323 excavator grinding rock at station 13+80 in Canal A-A.



☀ 343°N (T) ● 26°7'24"N, 81°47'2"W ±13ft ▲ 1ft



30 Apr 2024, 10:24:16

Contractor removing Epiroc grinder attachment from 323 excavator.

SW

240

W

270

NW

300

330

☉ 288°W (T) ☉ 26°7'24"N, 81°47'2"W ±13ft ▲ 13ft



30 Apr 2024, 11:13:08

Push boat taking fuel cube and Epiroc grinder to staging area.




☀ 162°S (T) 📍 26°8'14"N, 81°47'16"W ±13ft ▲ 11ft



30 Apr 2024, 12:07:58

Long reach excavator removing Epiroc grinder from hopper.

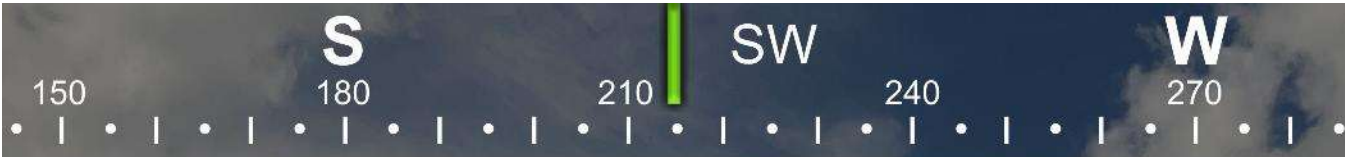

☀ 215°SW (T) ● 26°8'13"N, 81°47'16"W ±13ft ▲ 18ft



30 Apr 2024, 12:17:15

Push boat taking hopper back to Canal A-A.




☀ 11°N (T) ☉ 26°7'24"N, 81°47'2"W ±13ft ▲ 15ft



30 Apr 2024, 14:15:48

323 excavator removing sediment at station 14+50 in Canal A-A.

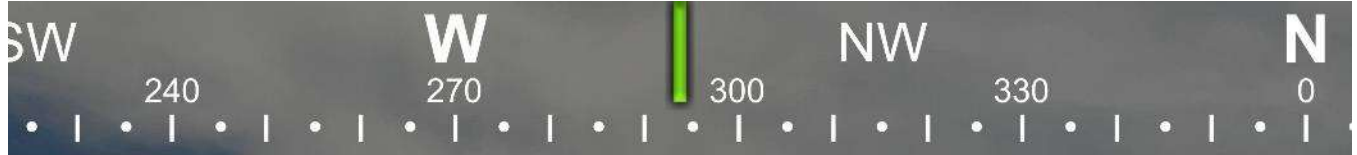


☀ 294°NW (T) ● 26°7'24"N, 81°47'3"W ±13ft ▲ 17ft



30 Apr 2024, 14:54:12

Push boat taking hopper to staging area.

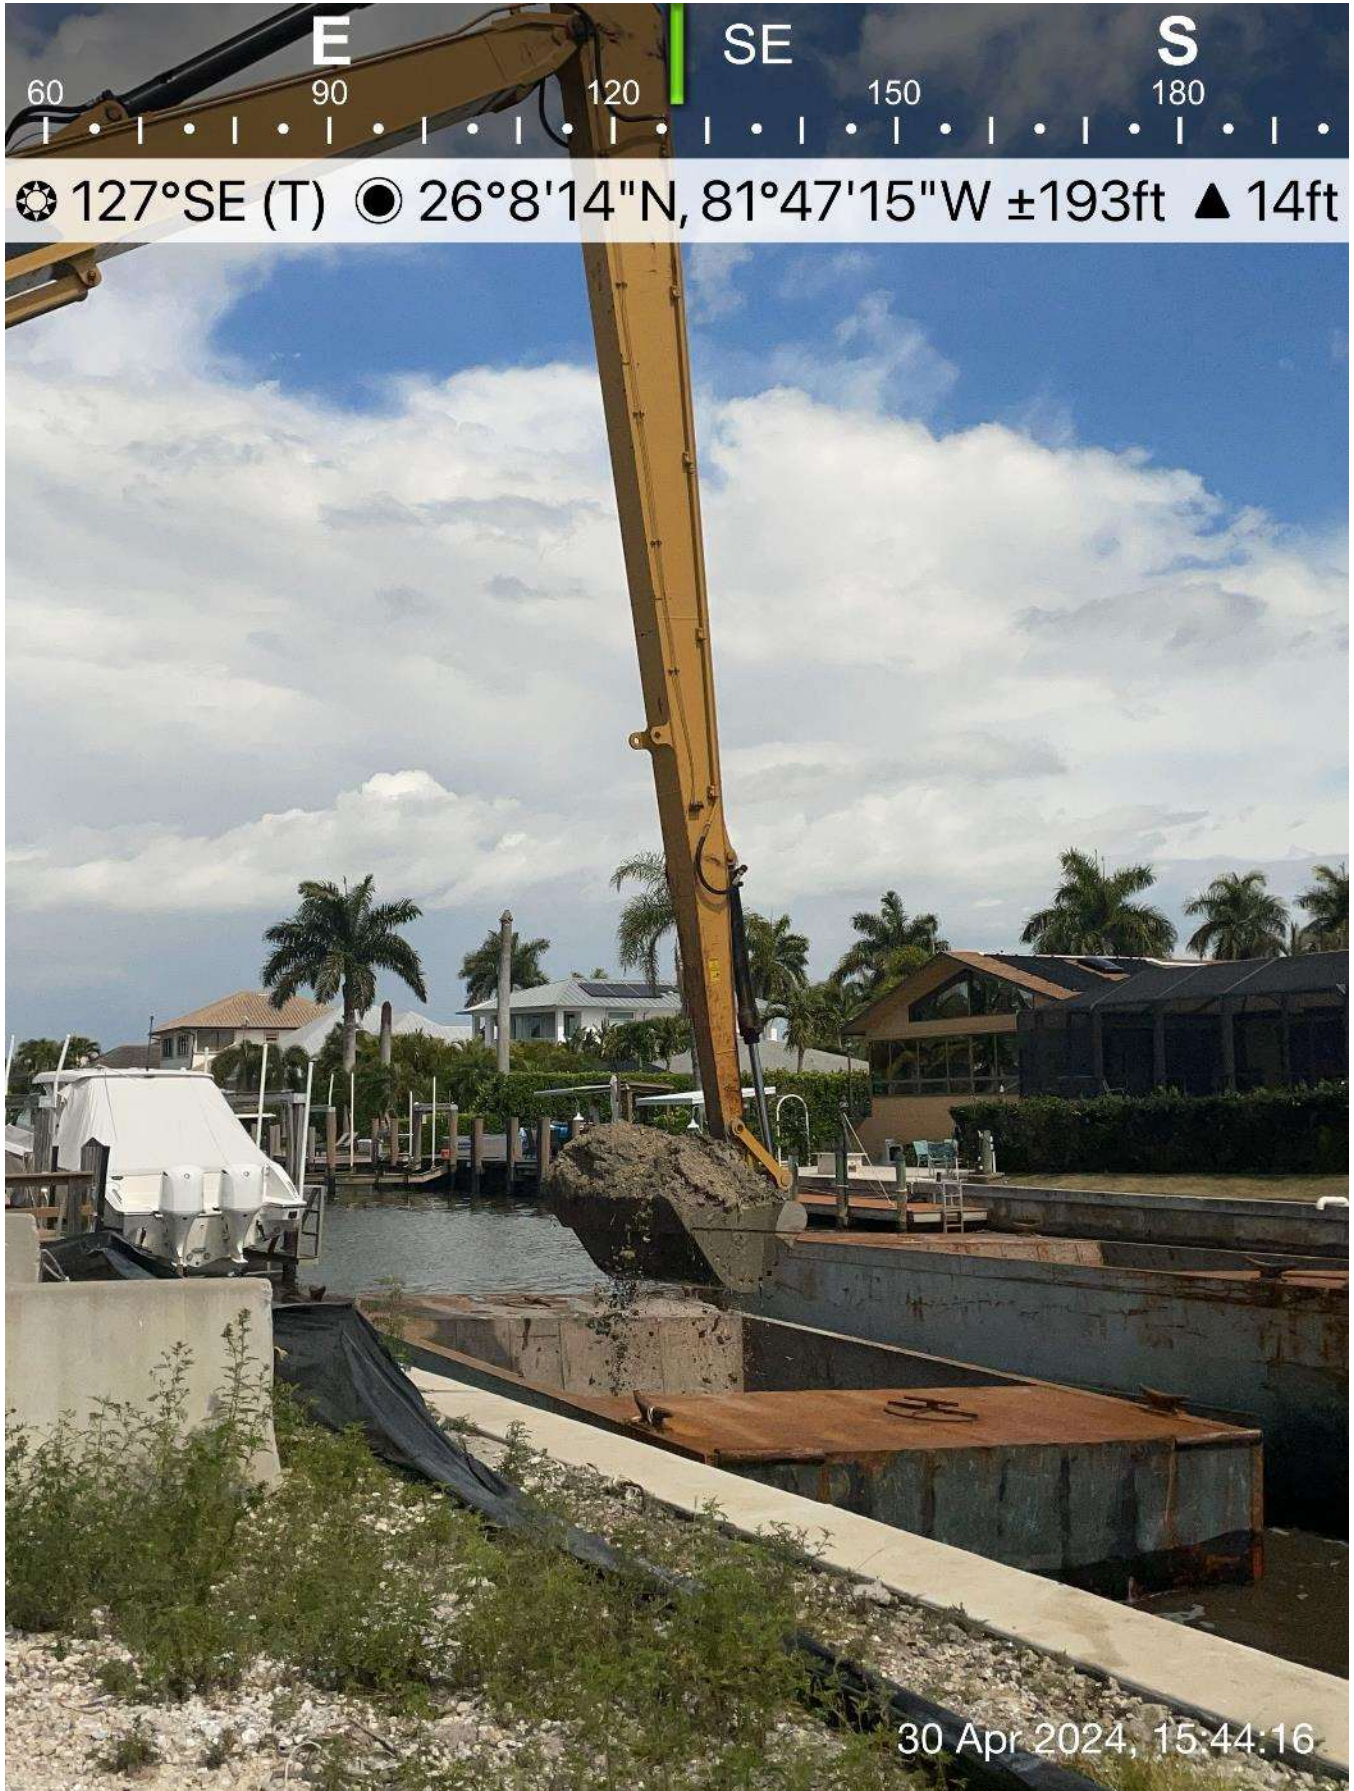


Long reach excavator removing sediment from hopper.

E SE S
60 90 120 150 180
☀ 127°SE (T) ☉ 26°8'14"N, 81°47'16"W ±13ft ▲ 16ft



Long reach excavator spreading sediment onto staging area.

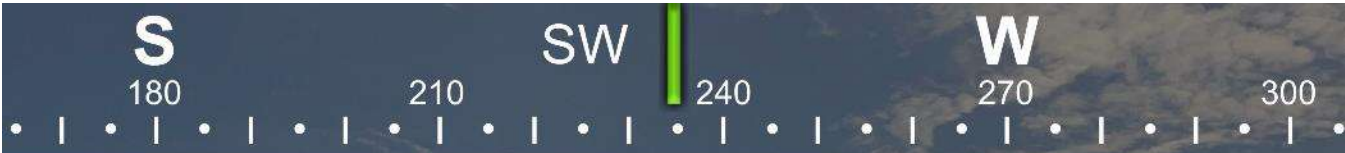

☉ 235°SW (T) ● 26°8'13"N, 81°47'16"W ±13ft ▲ 19ft



30 Apr 2024, 16:00:50

Push boat taking hopper back to Canal A-A.



☉ 14°N (T) ☉ 26°7'24"N, 81°47'2"W ±13ft ▲ 14ft



323 excavator removing sediment at station 14+00 in Canal A-A.



☉ 292°W (T) ☉ 26°7'24"N, 81°47'2"W ±9ft ▲ 17ft



30 Apr 2024, 17:04:13

Equipment staged at station 12+00 in Canal A-A.



DAILY REPORT OF CONSTRUCTION
 21-036 EAST NAPLES BAY
 DREDGING AND ROCK REMOVAL PROJECT



| | | | |
|------------------------------------|--------------------------------|---|----------------------------------|
| Date: 5/1/2024 | | | |
| Inspector: Mackenzie Hudson | Stantec PIN: 2028113191 | Accidents <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | |
| Day of Week: Wednesday | Contract Day: 220 | Week: 32 | Accident Report #: N/A |
| High Temp (°F): 87 °F | AM Conditions: Cloudy | PM Conditions: Cloudy | High Tide: 9:15 AM – 1.9' |
| Low Temp (°F): 69 °F | Wind: 3 to 5 mph | Wind: 8 mph | Low Tide: 2:09 PM – 1.7' |
| Canal Worked In: A-A | Stations Worked Between: | 14+00 to 13+80 | |

General

#1 – Prime Contractor – Quality Enterprises:

- Contractor transported hopper to staging area at 1300 Curlew Avenue from 8:55am to 9:35am. Contractor used long reach excavator to unload material from hopper onto staging area from 9:40am to 9:50am. Contractor transported the other hopper to Canal A-A from 9:55am to 10:30am.
- Port Consolidated delivered fuel to the staging area at 1300 Curlew Avenue from 9:10am to 9:20am.
- Canal sediment removal in progress today in Canal A-A starting, approximately, at station 14+00 moving toward station 13+80 in the southwest direction. No grinding, only sediment removal.
- Contractor dredged from 10:35am to 10:55am. Contractor transported hopper to staging area at 1300 Curlew Avenue from 11:00am to 11:40am. Contractor used long reach excavator to unload material from hopper onto staging area from 11:45am to 12:00pm. Contractor transported the other hopper to Canal A-A from 12:05pm to 12:40pm.
- Contractor dredged from 12:40pm to 1:15pm. Contractor did not transported hopper to staging area at 1300 Curlew Avenue. Contractor pumped water out of the barge before stopping work for the day. Contractor opened the canal and left site at 2:00pm.
- Contractor has a barge, an excavator, one hopper, and a push boat staged overnight at station 12+00 in Canal A-A and a support boat staged at station 6+00 in Canal A-A while working on this canal. Contractor also has one hopper staged in Canal CC-CC between stations 1+00 and 2+00. In addition, the contractor has a long reach excavator, Conex box, two (2) fuel cubes, and a water tank on trailer staged on the property located at 1300 Curlew Avenue, Naples, FL 34102. A GPS base station is also set up at this location during project work hours today.
- Two (2) hoppers of material removed.

| Contractor(s) and Personnel | | | | | | | | | | |
|------------------------------------|--------------------------------------|-----------------|---|------|-------------------|---|------|-----------------|---|------|
| # | Name | Type | # | Hrs. | Type | # | Hrs. | Type | # | Hrs. |
| 1 | Prime: Quality Enterprises | PM | 0 | 0 | Field Supervisor | 0 | 0 | Foreman | 0 | 0 |
| | | Skilled Laborer | 1 | 7 | Unskilled Laborer | 1 | 7 | Safety Director | 0 | 0 |

| Equipment | | | | | |
|------------------|-----------------|------------------------|----------|-----------|---------------------|
| Cont/ Sub # | Equipment ID | Description | # Pieces | # Used | Total Hours Used |
| 1 | N/A | Barge | 1 | 1 | 6 |
| 1 | CAT 323 | Excavator - Barge | 1 | 1 | 6 |
| 1 | CAT 326 | Excavator – Long Reach | 1 | 1 | 2 |
| 1 | FL6223TB | Push Boat | 1 | 1 | 6 |
| 1 | FL2474PP | Support Boat | 1 | 1 | 3 |
| 1 | N/A | Hopper | 2 | 2 | 6 |

| Visitors | | | |
|-----------------|---------|-------------------|-----|
| Name | Company | Hours at Job Site | |
| | | From: | To: |
| | | | |
| | | | |

| Inspector Name and Position | Hours at Job Site/Office | | Total Hours |
|-----------------------------|--------------------------|-----------------------|-------------|
| Mackenzie Hudson, EIT – CEI | From: 8:00 AM / 2:30 PM | To: 2:00 PM / 5:00 PM | 8.0 hours |




☀ 268°W (T) ● 26°7'24"N, 81°47'3"W ±13ft ▲ 8ft



01 May 2024, 08:54:25

Push boat taking hopper to staging area.

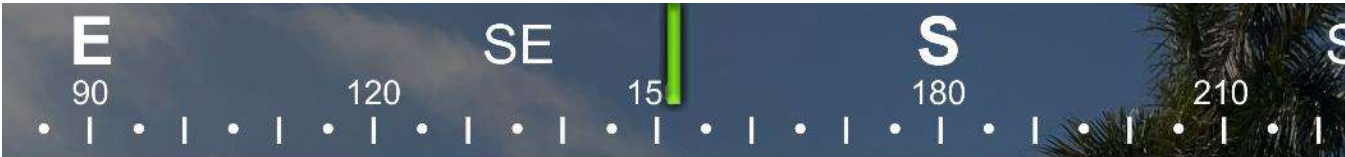

☀ 152°SE (T) ☉ 26°8'14"N, 81°47'16"W ±13ft ▲ 19ft



Port Consolidated delivering fuel to staging area.



☀ 122°SE (T) ● 26°8'13"N, 81°47'16"W ±13ft ▲ 20ft



01 May 2024, 09:41:06

Long reach excavator removing sediment from hopper.



☀ 130°SE (T) ● 26°8'14"N, 81°47'16"W ±13ft ▲ 27ft



01 May 2024, 09:41:46

Long reach excavator spreading sediment onto staging area.

S 180 SW 240 W 270 N 300
☀ 244°SW (T) ☉ 26°8'13"N, 81°47'16"W ±13ft ▲ 25ft



01 May 2024, 09:53:02

Push boat taking hopper back to Canal A-A.



☀ 6°N (T) ☉ 26°7'24"N, 81°47'2"W ±13ft ▲ 10ft



01 May 2024, 10:32:45

323 excavator removing sediment at station 14+00 in Canal A-A.

SW

240

W

270

NW

300

330

☉ 286°W (T) ● 26°7'24"N, 81°47'2"W ±9ft ▲ 13ft



Push boat taking hopper to staging area.

E SE S
60 90 120 150 180
☀ 124°SE (T) ☉ 26°8'13"N, 81°47'16"W ±13ft ▲ 16ft




Long reach excavator removing sediment from hopper.

E SE S
60 90 120 150 180
127°SE (T) 26°8'14"N, 81°47'16"W ±13ft ▲ 15ft



01 May 2024, 11:49:39

Long reach excavator spreading sediment onto staging area.

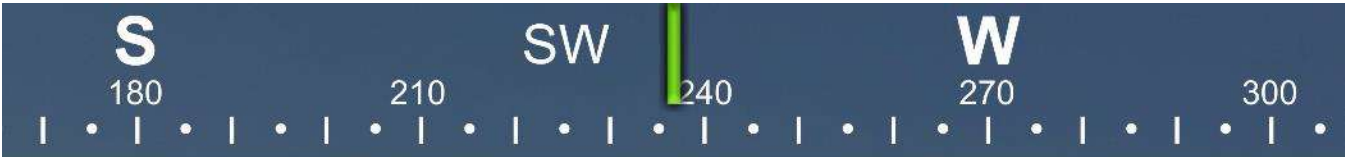

☀ 237°SW (T) ● 26°8'13"N, 81°47'16"W ±13ft ▲ 20ft



01 May 2024, 12:05:40

Push boat taking hopper back to Canal A-A.



323 excavator removing sediment at station 13+80 in Canal A-A.



☀ 280°W (T) ● 26°7'24"N, 81°47'3"W ±13ft ▲ 11ft



01 May 2024, 13:25:54

Contractor pumping water out of barge.



DAILY REPORT OF CONSTRUCTION
 21-036 EAST NAPLES BAY
 DREDGING AND ROCK REMOVAL PROJECT



| | | | |
|------------------------------------|--------------------------------|---|----------------------------------|
| Date: 5/2/2024 | | | |
| Inspector: Mackenzie Hudson | Stantec PIN: 2028113191 | Accidents <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | |
| Day of Week: Thursday | Contract Day: 221 | Week: 32 | Accident Report #: N/A |
| High Temp (°F): 88 °F | AM Conditions: Sunny | PM Conditions: Cloudy | High Tide: 9:56 AM – 2.1' |
| Low Temp (°F): 69 °F | Wind: 7 to 10 mph | Wind: 6 to 8 mph | Low Tide: 3:20 PM – 1.3' |
| Canal Worked In: A-A | Stations Worked Between: | 13+50 to 13+00 | |

General

#1 – Prime Contractor – Quality Enterprises:

- Mechanic performed maintenance on the Epiroc grinder and 323 excavator at the staging area at 1300 Curlew Avenue from 8:30am to 3:00pm.
- Contractor used long reach excavator to unload material from hopper onto staging area from 1:10pm to 1:20pm. Contractor transported the other hopper to Canal A-A from 1:25pm to 2:05pm.
- Canal sediment removal in progress today in Canal A-A starting, approximately, at station 13+50 moving toward station 13+00 in the southwest direction. No grinding, only sediment removal.
- Contractor dredged from 2:10pm to 2:35pm. Contractor transported hopper to staging area at 1300 Curlew Avenue from 2:40pm to 3:25pm. Contractor used long reach excavator to unload material from hopper onto staging area from 3:30pm to 3:40pm while the push boat transported the other hopper to Canal A-A from 3:30pm to 4:15pm.
- Mechanics transported Epiroc grinder off site at 3:50pm.
- Contractor dredged from 4:20pm to 4:40pm. Contractor did not transport hopper to staging area at 1300 Curlew Avenue. Contractor staged the equipment and opened the canal at 5:00pm.
- Contractor has a barge, an excavator, one hopper, and a push boat staged overnight at station 12+00 in Canal A-A and a support boat staged at station 6+00 in Canal A-A while working on this canal. Contractor also has one hopper staged in Canal CC-CC between stations 1+00 and 2+00. In addition, the contractor has a long reach excavator, Conex box, two (2) fuel cubes, and a water tank on trailer staged on the property located at 1300 Curlew Avenue, Naples, FL 34102. A GPS base station is also set up at this location during project work hours today.
- Two (2) hoppers of material removed.

| Contractor(s) and Personnel | | | | | | | | | | |
|------------------------------------|--------------------------------------|-----------------|---|------|-------------------|---|------|-----------------|---|------|
| # | Name | Type | # | Hrs. | Type | # | Hrs. | Type | # | Hrs. |
| 1 | Prime: Quality Enterprises | PM | 0 | 0 | Field Supervisor | 0 | 0 | Foreman | 0 | 0 |
| | | Skilled Laborer | 2 | 10 | Unskilled Laborer | 1 | 10 | Safety Director | 0 | 0 |

| Equipment | | | | | |
|------------------|-----------------|------------------------|----------|-----------|---------------------|
| Cont/ Sub # | Equipment ID | Description | # Pieces | # Used | Total Hours Used |
| 1 | N/A | Barge | 1 | 1 | 4 |
| 1 | CAT 323 | Excavator - Barge | 1 | 1 | 4 |
| 1 | CAT 326 | Excavator – Long Reach | 1 | 0 | 2 |
| 1 | FL6223TB | Push Boat | 1 | 1 | 4 |
| 1 | FL2474PP | Support Boat | 1 | 1 | 1 |
| 1 | N/A | Hopper | 2 | 2 | 4 |

| Visitors | | | |
|-----------------|---------|-------------------|-----|
| Name | Company | Hours at Job Site | |
| | | From: | To: |
| | | | |
| | | | |

| Inspector Name and Position | Hours at Job Site/Office | | Total Hours |
|-----------------------------|--------------------------|-------------|-------------|
| Mackenzie Hudson, EIT – CEI | From: 8:00 AM | To: 5:00 PM | 8.0 hours |



☀ 139°SE (T) ● 26°8'14"N, 81°47'16"W ±13ft ▲ 17ft



Mechanic arriving at staging area.



☉ 198°S (T) ☉ 26°8'14"N, 81°47'16"W ±9ft ▲ 16ft



02 May 2024, 08:18:27

Equipment arriving at staging area.

SE S SW
120 150 180 210 240
☀ 176°S (T) ☉ 26°8'15"N, 81°47'16"W ±13ft ▲ 10ft



Mechanic working on Epiroc grinder.

NW N NE
300 330 0 30 60
357°N (T) 26°8'15"N, 81°47'16"W ±9ft ▲ 16ft



Mechanic working on 323 excavator.



☀ 129°SE (T) ☉ 26°8'13"N, 81°47'16"W ±13ft ▲ 19ft



Long reach excavator removing sediment from hopper.



☀ 127°SE (T) ☉ 26°8'14"N, 81°47'16"W ±13ft ▲ 14ft



Long reach excavator spreading sediment onto staging area.



☉ 223°SW (T) ● 26°8'13"N, 81°47'16"W ±13ft ▲ 14ft



Push boat taking barge and hopper back to Canal A-A.



☉ 2°N (T) ☉ 26°7'24"N, 81°47'3"W ±13ft ▲ 12ft



02 May 2024, 14:11:42

323 excavator removing sediment at station 13+50 in Canal A-A.

W 270 NW 300 330 N 0 NE 30

☀ 339°N (T) ☉ 26°7'25"N, 81°47'3"W ±13ft ▲ 15ft



02 May 2024, 14:29:41

323 excavator removing sediment at station 13+25 in Canal A-A.



☀ 279°W (T) ● 26°7'24"N, 81°47'3"W ±9ft ▲ 33ft



02 May 2024, 14:41:40

Push boat taking hopper to staging area.



☀ 135°SE (T) ● 26°8'13"N, 81°47'16"W ±13ft ▲ 14ft



Long reach excavator removing sediment from hopper.



☀ 120°SE (T) ● 26°8'14"N, 81°47'16"W ±13ft ▲ 12ft



Long reach excavator spreading sediment onto staging area.



☉ 227°SW (T) ☉ 26°8'13"N, 81°47'16"W ±13ft ▲ 14ft



Push boat taking hopper back to Canal A-A.

E 90 SE 120 150 S 180 210
☀ 146°SE (T) ☉ 26°8'15"N, 81°47'16"W ±13ft ▲ 12ft



Epiroc grinder loaded onto trailer.



☀ 315°NW (T) ● 26°7'24"N, 81°47'2"W ±13ft ▲ 12ft



323 excavator removing sediment at station 13+00 in Canal A-A.

SW

240

W

270

NW

300

330

☀ 288°W (T) ● 26°7'24"N, 81°47'2"W ±9ft ▲ 11ft



02 May 2024, 16:45:10

Equipment staged at station 12+00 in Canal A-A.



DAILY REPORT OF CONSTRUCTION
 21-036 EAST NAPLES BAY
 DREDGING AND ROCK REMOVAL PROJECT



| | | | |
|------------------------------------|--------------------------------|---|-----------------------------------|
| Date: 5/3/2024 | | | |
| Inspector: Mackenzie Hudson | Stantec PIN: 2028113191 | Accidents <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | |
| Day of Week: Friday | Contract Day: 222 | Week: 32 | Accident Report #: N/A |
| High Temp (°F): 90 °F | AM Conditions: Sunny | PM Conditions: Cloudy | High Tide: 10:25 AM – 2.3' |
| Low Temp (°F): 68 °F | Wind: 7 to 9 mph | Wind: 3 to 11 mph | Low Tide: 4:18 PM – 0.8' |
| Canal Worked In: A-A | Stations Worked Between: | 12+75 to 12+50 | |

General

#1 – Prime Contractor – Quality Enterprises:

- Contractor transported hopper to staging area at 1300 Curlew Avenue from 8:20am to 9:00am. Contractor used long reach excavator to unload material from hopper onto staging area from 9:05am to 9:20am while push boat transported the other hopper to Canal A-A from 9:05am to 9:40am.
- Canal sediment removal in progress today in Canal A-A starting, approximately, at station 12+75 moving toward station 12+50 in the southwest direction. No grinding, only sediment removal.
- Contractor dredged from 9:45am to 10:00am. Contractor transported hopper to staging area at 1300 Curlew Avenue from 10:05am to 10:45am. Contractor used long reach excavator to unload material from hopper onto staging area from 10:50am to 11:10am while the push boat transported the other hopper to Canal A-A from 10:55am to 11:30am.
- Contractor dredged from 11:35am to 12:00pm. Contractor transported hopper to staging area at 1300 Curlew Avenue from 12:30pm to 1:05pm. Contractor used long reach excavator to unload material from hopper onto staging area from 1:10pm to 1:30pm while the push boat transported the other hopper to Canal A-A from 1:10pm to 1:50pm.
- Contractor exited Canal A-A, staged the equipment, and opened the canal at 2:00pm.
- Contractor secured tires along seawall at the staging area at 1300 Curlew Avenue.
- Contractor has a barge, an excavator, one hopper, a support boat, and a push boat staged overnight at station 4+00 in Canal Main B1 while working on this canal. Contractor also has one hopper staged in Canal CC-CC between stations 1+00 and 2+00. In addition, the contractor has a long reach excavator, Conex box, two (2) fuel cubes, and a water tank on trailer staged on the property located at 1300 Curlew Avenue, Naples, FL 34102. A GPS base station is also set up at this location during project work hours today.
- Three (3) hoppers of material removed.

| Contractor(s) and Personnel | | | | | | | | | | |
|------------------------------------|--------------------------------------|-----------------|---|------|-------------------|---|------|-----------------|---|------|
| # | Name | Type | # | Hrs. | Type | # | Hrs. | Type | # | Hrs. |
| 1 | Prime: Quality Enterprises | PM | 0 | 0 | Field Supervisor | 0 | 0 | Foreman | 0 | 0 |
| | | Skilled Laborer | 2 | 9 | Unskilled Laborer | 1 | 9 | Safety Director | 0 | 0 |

| Equipment | | | | | |
|------------------|-----------------|------------------------|----------|-----------|---------------------|
| Cont/ Sub # | Equipment ID | Description | # Pieces | # Used | Total Hours Used |
| 1 | N/A | Barge | 1 | 1 | 6 |
| 1 | CAT 323 | Excavator - Barge | 1 | 1 | 6 |
| 1 | CAT 326 | Excavator – Long Reach | 1 | 1 | 4 |
| 1 | FL6223TB | Push Boat | 1 | 1 | 6 |
| 1 | FL2474PP | Support Boat | 1 | 1 | 3 |
| 1 | N/A | Hopper | 2 | 2 | 6 |

| Visitors | | | |
|-----------------|---------|-------------------|-----|
| Name | Company | Hours at Job Site | |
| | | From: | To: |
| | | | |
| | | | |

| Inspector Name and Position | Hours at Job Site/Office | | Total Hours |
|-----------------------------|--------------------------|-----------------------|-------------|
| Mackenzie Hudson, EIT – CEI | From: 8:00 AM / 4:30 PM | To: 4:00 PM / 5:00 PM | 8.0 hours |



☉ 269°W (T) ● 26°7'24"N, 81°47'3"W ±13ft ▲ 5ft



03 May 2024, 08:21:25

Push boat taking hopper to staging area.



☉ 118°SE (T) ● 26°8'13"N, 81°47'16"W ±9ft ▲ 39ft



03 May 2024, 09:04:48

Long reach excavator removing sediment from hopper.



☉ 134°SE (T) ● 26°8'14"N, 81°47'16"W ±13ft ▲ 22ft



03 May 2024, 09:05:29

Long reach excavator spreading sediment onto staging area.



☉ 229°SW (T) ● 26°8'13"N, 81°47'16"W ±13ft ▲ 14ft



03 May 2024, 09:05:52

Push boat taking hopper back to Canal A-A.

SW W NW
210 240 270 300 330

☀ 273°W (T) ☉ 26°7'24"N, 81°47'3"W ±13ft ▲ 14ft



03 May 2024, 09:45:00

323 excavator removing sediment at station 12+75 in Canal A-A.

S 180 SW 210 24 W 270 300 N
☉ 242°SW (T) ☉ 26°7'19"N, 81°47'6"W ±13ft ▲ 5ft



03 May 2024, 10:04:37

Push boat taking hopper to staging area.

NE 60 E 90 SE 150 180 S
110°E (T) 26°8'13"N, 81°47'16"W ±13ft ▲ 14ft



03 May 2024, 10:51:03

Long reach excavator removing sediment from hopper.

E 90 SE 120 150 S 180
☀ 135°SE (T) ☉ 26°8'14"N, 81°47'16"W ±13ft ▲ 13ft



Long reach excavator spreading sediment onto staging area.



☉ 264°W (T) ● 26°7'24"N, 81°47'2"W ±13ft ▲ 9ft



03 May 2024, 11:36:51

323 excavator removing sediment at station 12+50 in Canal A-A.



☉ 141°SE (T) ☉ 26°8'13"N, 81°47'16"W ±9ft ▲ 17ft



03 May 2024, 13:10:30

Long reach excavator removing sediment from hopper.



☀ 126°SE (T) ☉ 26°8'14"N, 81°47'16"W ±13ft ▲ 12ft



Long reach excavator spreading sediment onto staging area.



☀ 235°SW (T) ● 26°8'13"N, 81°47'16"W ±13ft ▲ 13ft



03 May 2024, 13:11:58

Push boat taking hopper back to Canal A-A.

S 180 SW 210 W 270

☉ 224°SW (T) ☉ 26°7'19"N, 81°47'6"W ±13ft ▲ 2ft



03 May 2024, 14:02:39

Contractor exiting Canal A-A.

SE S SW
120 150 180 210 240
☀ 175°S (T) ● 26°7'24"N, 81°46'57"W ±13ft ▲ 14ft



03 May 2024, 14:44:22

Equipment staged at station 4+00 in Canal Main B1.



☉ 90°E (T) ☉ 26°8'15"N, 81°47'16"W ±9ft ▲ 4ft



03 May 2024, 14:50:07

Contractor securing tires along seawall at staging area.